



Product Description

3M™ FASARA™ Glass Finishes (the “Products”) are decorative glass and window films available in over 100 designs. These decorative Products can be used in vertical applications in commercial buildings to control both light and privacy through a building’s interior glass, including the interior of an outside glass wall (the “Interior Applications”). 3M FASARA Whiteboard Finish WH-111-G has a writable and erasable surface that can be used to convert interior glass surfaces into creative, collaborative environments. 3M™ DI-NOC™ Glass Finishes are decorative films for application directly behind glass. Additional information on the current Product line can be found in the respective technical data sheets for each Product line and the *3M™ Glass Finishes Product Catalog* (the “Catalog”).

Application Surfaces

Based on available test data, the following application surfaces are recommended:

- Interior glass
- Interior of an outside glass wall (except 3M DI-NOC Glass Finishes)

Mat Crystal 2 (SH2MACRX2) and Milky Crystal (SH2MLCRX) are designated for use on the exterior of an outside glass wall (the “Exterior Applications”). However, due to the variability of local climates users must proceed on a test and approve basis, and user assumes all risk related to the installation. Exterior Applications are not warranted.

Plastic application surfaces can be used on user test and approve basis, but are not warranted.

NOTE: Some plastic application surfaces can outgas. Outgassing is the release of a gas as certain plastics or coated surfaces dry and cure. This occurs over a period of time, but not indefinitely. Product that is applied to a surface that is still outgassing will develop air bubbles in the Product that may appear some time after the installation.

3M assumes no liability for bubbles that appear in the applied Product due to outgassing.

Suggested Test for Outgassing of Plastic Application Surfaces

1. Apply a 5 in. x 5 in. (135mm x 135mm) piece of the Product to the plastic application surface in question.
2. If possible, oven bake the sample for 2 hours at 150°F (65°C) or bake for 5 minutes at 350°F (176°C). If oven baking is not an option, allow the sample to sit at room temperature for 24 hours.
3. Examine the sample. Bubbles under the Product indicate that the plastic application surface is outgassing. If no bubbles occur, the application surface is not outgassing.
4. To estimate how long outgassing may continue, repeat the test daily, using a new sample, until bubbles no longer appear under the Product.
5. If outgassing continues for a long period of time, consult the plastic manufacturer for assistance.

The user is solely responsible for evaluating and determining whether these 3M Products are suitable and appropriate for any particular use or manufacturing process in which they may be used.

High Humidity Conditions

Do not install FASARA Glass Finishes in locations in which the film may frequently come into contact with water or where condensation often occurs.

Seams in WH-111-G

Seams in FASARA Whiteboard Finish WH-111-G tend to accumulate marker residue. Make seams as tight as possible.

Installation Tools and Supplies

- Rubber application squeegee, 4 in., rubber hardness 80, 6mm or greater thickness, nick free
- 3M™ Hand Applicator PA-1 (Blue or Gold) with 3M™ 5491 PTFE tape applied to the edges of the hand applicator
- 4 in. Window scraper with stainless steel replacement blades
- 8 in. Window cleaning squeegee with replacement rubbers
- Razor blade knife with stainless steel replacement break-away blades
- Ruler with nick-free edges
- Scotch™ Masking Tape
- Clean, lint-free paper towels
- Drop cloths (absorbent) or plastic sheeting
- Spray bottle (garden style 1 - 2 gallon, low pressure sprayer works well)
- Water
- Mild, non-lotion containing liquid detergent; no soaps, waxes, oils, or enzymes
- Isopropyl alcohol (70% or industrial strength)



Standard Squeegee
(for 3M™ FASARA™)

Figure 1. Felt-wrapped and rubber squeegees for 3M™ FASARA installation

Surface and Work Area Preparation

Use the following steps to prepare the application surface for Product application. An experienced installer's techniques may vary.

Prepare the Application Solution

Prepare a water and liquid detergent solution to use for applying the finish. It should have a concentration of approximately 0.1% to 0.2% detergent. A solution of about 1 teaspoon of mild detergent to 1 gallon of water is sufficient for about 36 square yards of application surface. Pour this solution into your sprayer.

- High detergent concentration causes the applicator and finish to slip, resulting in insufficient application pressure.
- Low detergent concentration causes the finish to stick or prevents the squeegee from traveling smoothly across the finish, which results in an inconsistent application and leaves excess water behind.

Prepare the Installation Area

- Protect the areas surrounding the installation from the application solution over spray and drips, using masking tape and/or drop cloths as appropriate.
- If possible, turn off or cover the heating or air conditioning units and ventilation ducts in the application area prior to starting the installation.
- For the best bonding conditions, the recommended application temperature is 54°F - 100°F (12°C - 38°C) and the application surface should be at room temperature or higher. In the lower end of this range, additional application pressure on the Product can encourage better adhesive bonding. Attempting to install the Product at temperatures below the recommended range can cause the adhesive to become so firm that it will not develop maximum contact with the application surface.

Check the Application Surface for Coatings

Many application surfaces have wax or other invisible coatings on them that interfere with adhesion. Use the following procedure to identify and eliminate such coatings. Be sure your customer understands and agrees with this procedure.

- Place drops of water on several areas of the application surface. Water beads indicate that the glass or plastic has a coating that must be removed for good Product adhesion.
- Saturate a lint-free paper towel with 70% isopropyl alcohol (IPA) and wipe clean the application surface. Wipe the application surface clean before the IPA evaporates with a lint-free paper towel.
- Check again for water beading. If there is no beading, proceed with application surface preparation.

Clean the Application Surface

1. Place drop cloths and/or plastic sheeting to protect the application area below the application surface.
2. Spray the application solution on the application surface.

3. Scrape glass to remove dirt and other contaminants on the surface of the glass.

NOTE: Do not scrape plastic surfaces as this will cause scratches that may show through the Product.

4. Thoroughly rinse the application surface using the sprayer, then squeegee the entire application surface, wiping the squeegee after each stroke.
5. Dry the application surface edge and frame thoroughly.
6. Apply the Product per the installation procedure immediately after cleaning the application surface. Any dirt or contaminants which settle on the application surface after cleaning will inhibit adhesion and may be visible after application.

Installation Procedure

NOTE: Bring the Product to room temperature before installation.

Measure and Cut the Panels

- If panels are installed adjacent to each other, ensure that the panels are from the same lot. Different lots of the Product can have slight color variations that may be noticeable at seams.
- If film panels are installed adjacent to each other, the panels should be alternated up and down in order to accommodate slight color variations.

Product panels may be cut to size by hand. If cut by hand, any nicks or burrs on the edge of the ruler used to mark and cut the finish could scratch it. Apply masking tape to the side of the ruler that contacts the finish to help prevent damage. Use a very sharp cutting blade to ensure clean, smooth edges.

Installation Procedure

Recommended application temperature: 54°F - 100°F (16°C - 38°C)

These are the general Product application steps. An experienced Product applicator's techniques may vary.

NOTE: Always handle the finish with care. It is relatively thin and can fold upon itself easily.

Remove the Liner and Wet the Adhesive

1. Generously spray the application surface with the application solution.

NOTE: 3M™ DI-NOC™ Glass Finishes has the liner on the pattern side of the film. The pattern side contacts the glass application surface.

2. Lay the FRONT SIDE of the Product against the application surface so the liner is facing you.

NOTE: It is recommended to leave at least 1/4 in. of film overlapping the edges of the application surface to be trimmed after squeegeeing the film. This improves the adhesion of the film edges to the application surface.

3. Peel back a few inches of the liner. Be sure you pull the liner away from the Product, not the Product from the liner, to avoid stretching the Product.
4. Generously spray the exposed adhesive with the application solution.
5. Continue peeling back the liner and spraying the adhesive with the application solution until the liner is completely removed.

NOTE: If the Product panel is large, you may need assistance for the next steps.

6. Flip the Product and position it on the wetted application surface so the adhesive contacts the application surface.

Apply Product

1. Recheck the alignment, spray the surface of the Product with application solution to reduce friction.

NOTE: For 3M™ DI-NOC™ Glass Finish, check the non-application side of the glass for alignment.

2. Apply the Product using a hand applicator.
3. Starting at the top in the center of the finish, use firm and consistent pressure, making overlapping strokes from center to edges with the applicator. The goal is to push the water out to the edges so the adhesive makes good contact with the application surface.
4. For the rest of the panel, move the applicator down to overlap the previous strokes by about 50%, and stroke from center to edge, center to edge again, until the panel is fully applied.
5. Trim the film edges overlapping the application surface if needed.
6. Wipe the edges of the Product with a clean, lint-free towel to remove any drips.

NOTE: The surfaces of some 3M™ FASARA™ patterns are not smooth. A small amount of application solution remains on the surface of the finish after squeegeeing, potentially causing an uneven visual appearance until it dries.

NOTE: For FASARA Silky, when using masking tape, use low adhesion masking tape and remove tape as soon as possible after installation.

Using Finishes from Different Product Categories

If combining finishes, for example to compliment a gradation pattern using a different finish of the same color, check the color between the panels before installation. Although different Product categories may have the same color, the differences in the product construction and lot may be apparent when used side by side.

Cleaning and Maintenance

After the application is complete, some application solution may remain between the glass and the finish. This causes small water bubbles or clouding that disappears as the water evaporates. This can take up to several days, depending on environmental conditions.

- Do NOT touch the finish during this time.
- Protect the finish from abuse.

NOTE: The Product may be cleaned beginning 30 days after installation.

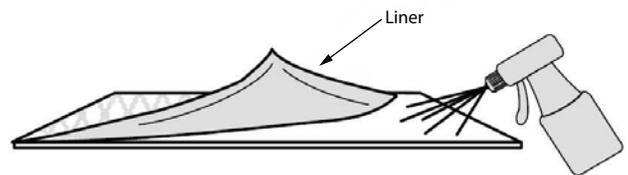


Figure 2. Peel back some liner and spray the adhesive.

3M™ FASARA™ & 3M™ DI-NOC™ Glass Finishes

Cleaning Applied Product

Regular cleaning will help maintain the Product's appearance. Use only clean, nick-free tools and wipe gently only in one direction. Do not use ammonia, chlorine, or organic-based cleaning products, polishing or cleaning compound, sponges, brushes or electric polishing equipment:

- If there is dust and grit, wipe it off with a soft, damp cloth.
- If it is soiled, but not gritty, use water and squeegee.
- If there is heavier soil, use a mild liquid detergent and water solution, then clear water, and wipe gently with a cloth wipe.

NOTE: Additional caution is recommended when cleaning spliced areas. Always clean in the direction of the splice.

NOTE: For 3M™ DI-NOC™ Glass Finishes, the front glass surface can be cleaned by standard glass cleaning methods.

Removal

The Product can be removed with low heat or the use of 3M™ Adhesive Remover Citrus Base and a scraper with a stainless steel blade.

Transportation and Storage

- 40° to 90°F (4° to 32°C)
- Away from direct sunlight
- Clean dry area
- Original container

Health and Safety

CAUTION

When handling any chemical products, read the manufacturers' container labels and the Safety Data Sheets (SDS) for important health, safety and environmental information. To obtain SDS sheets for 3M products go to 3M.com/SDS, or by mail or in case of an emergency, call 1-800-364-3577 or 1-651-737-6501.

When using any equipment, always follow the manufacturers' instructions for safe operation.

WARNING

To reduce the risks of personal injury and/or property damage associated with glass breakage:

A glass surface covered by a film with areas of high opacity or dark-colored ink will absorb more heat than other glass surfaces when exposed to sunlight. Heat absorption can create thermal expansion that could result in glass breakage or cracking. Do not use a film with areas of high opacity or dark-colored ink on glass surfaces with significant exposure to sunlight.

Technical Information

Technical information and data, recommendations, and other statements provided by 3M are based on information, tests, or experience which 3M believes to be reliable, but the accuracy or completeness of such information is not guaranteed. Such technical information and data are intended for persons with knowledge and technical skills sufficient to assess and apply their own informed judgment to the information. The typical values shown should not be used for the purpose of specification limits. If you have questions about this Product, contact the Technical Service helpline at 1-888-650-3497.

Warranty

Please refer to the applicable product's technical data sheet for warranty information.

Commercial Solutions

3M Center, Building 220-12E-04
St. Paul, MN 55144

1-888-650-3497
3M.com/AMD

© 3M 2019. All rights reserved.
3M, FASARA, SCOTCH and DI-NOC are trademarks of 3M. Used under license in Canada.
All other trademarks are property of their respective owners.
Revision F, June 2019 Please recycle.

3M Science.
Applied to Life.™